



LEMO USA, Inc.
635 Park Court
P.O. Box 2408
Rohnert Park, CA 94927-2408

Main (707) 578-8811
Toll Free (800) 444-5366
Fax (707) 578-0869

PRODUCT UPDATE

N°052 Page 1/1
By: Jim McLaughlin
Date: November 1, 2007

LEMO F series crimp contact change & new positioner

Dear Valued Customer,

The crimp contacts used in reverse gender applications (female contact within male plug) supplied in the following LEMO F series connectors have been modified in order to improve performance.


FGS.3F.322.XLM	FGS.3F.322.YLM
FGS.3F.330.XLM	FGS.3F.330.XLMF
FGS.3F.330.XLMS	FGS.3F.330.YLM
FGT.3F.330.XLM	FGT.3F.330.XLMS
FGS.3F.330.U0450*	FGT.3F.330.U0450*
FGS.3F.330.XLP	FGT.3F.330.XLP




(* Special versions w/custom sleeve)

The modification makes the contact less susceptible to damage by shortening the contact length (dimension "S" is shortened by 0.5mm). This modification requires that a new positioner be used in the contact crimping process.

EGN.3F.655.ZZM is the new crimp contact (Fig 1.) part number. It replaces EGG.1B.655.ZZM.

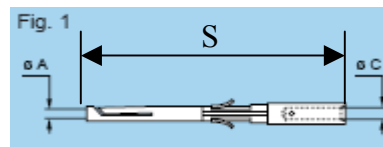

EGN.3F.656.ZZM is the optional reduced crimp barrel (Fig. 2) contact. It replaces EGG.1B.656.ZZM.

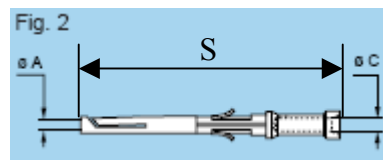

DCE.91.071.FVM is the associated new positioner tool for this new crimp contact.

